

**2001–02 Civic: MIL Comes On With DTC P0128****(Supersedes 03-002, dated July 23, 2011, to update the information marked by the black bars)****REVISION SUMMARY**

Under WARRANTY CLAIM INFORMATION, a flat rate time was changed.

**SYMPTOM**

The MIL is on, and DTC P0128 (Thermostat Range/Performance Problem) is set.

NOTE: If your PGM Tester is not loaded with current software, it may indicate DTC P1486. This DTC is the same as P0128.

**PROBABLE CAUSE**

In the ECM/PCM software, the parameters for monitoring DTC P0128 and P1486 are too narrow, causing a code to set.

**CORRECTIVE ACTION**

Update the ECM/PCM software (with January 2003 or later software).

**WARRANTY CLAIM INFORMATION**

The normal warranty applies.

Operation Number: 125517

Flat Rate Time: 0.3 hour

Failed Part: P/N 37820-PLR-L54

Defect Code: 091

Contention Code: B02

Skill Level: Repair Technician

**REPAIR PROCEDURE**

1. Update the ECM/PCM software. Refer to Service Bulletin 01-023, *Updating Control Units/Modules*.