

DTC P0740 Set? Check for Contaminated Solenoids

AFFECTED VEHICLES

2002 Civic

If you're servicing a vehicle with A/T, and DTC P0740 (problem in lock-up control system) is set, check for contaminated solenoids before you replace the A/T (see the electronic service manual for details.) If the torque converter clutch solenoid valve or the A/T clutch pressure solenoid valves A and B are contaminated, replace them.

Honda Transmission Manufacturing's Market Quality department analyzed 12 A/Ts that were replaced for this DTC. Here's what they found:

- 11 of the 12 A/Ts had contaminated solenoids
- After replacing the torque converter clutch solenoid valve and the A/T clutch pressure control solenoid valves A and B on all 12 A/Ts, only one had a comeback for DTC P0740.